Ref No:
Rev.No:0
Page 1 of 12

Serial	Sub-Activities	Hazards Identified	Risks Involved		Risk Rating		Control Measures	Residual
No.		(Generic & Task)	(People & Property)	Severity	Probability	Initial Risk		Risk
1.	Prepare work area	• Unauthorized, untrained workers	CutsAbrasions	2	А	L	 TBT/DSTI to be conducted by the foreman/ safety officer prior to work commencement Task specific safety training to be provided Authorized personnel to undertake the job Daily safety inspection should be carried and eliminate the hazard. 	Low (ALARP)
2.	Manual Handling	 Incorrect lifting of loads Sharp edges. Placing the object while fingers underneath. Slip/trip/fall (same level) Unsafe posture 	 Back Injuries Cut to finger Strain Musculoskeletal Injuries 	3	С	М	 Any lifting tasks shall be carried out by persons physically capable to do so No employee should be asked to carry loads above his capacity and in any case no load shall exceed 30kg per man. Mass of the load is more then to be equally shared Deploy enough number of personnel for lifting shall be appointed to the task depending upon the type of load to be lifted. Use easy mode of transport like trolley etc. Load not to be lifted above your shoulder Height Keep your fingers away from pinch point While placing the load Area to be illuminated with adequate lighting. Proper personal protective equipments to be used while manual handling of materials and loads. 	Low (ALARP)

Ref No:
Rev.No:0
Page 2 of 12

Serial	Sub-Activities	Hazards Identified	Risks Involved	Risk Rating				Residual
No.		(Generic & Task)	(People & Property)	Severity	Probability	Initial Risk	Control Measures	Risk
3.	Stacking and Storing	 Unauthorized, untrained workers Material fall from height Improper stacking Collapse of materials 	 Crush Cut and abrasion Damage to property 	3	В	М	 All materials shall be stored below 2 meter height. If the material is too heavy, use hydraulic trolley to shift the material. No storage of materials to be done in the work place, only required quantity to be taken for the job. Personnel protective equipment must wear at all time during the activity. (Helmet, shoe, vest, overall, gloves, goggles, mask.) 	Low (ALARP)
4.	Unloading, shifting of pumps to site using with trailer, pickup, fork lift and crane	 Unauthorized, Untrained Workers Failure of lifting equipment Failure of lifting tools & tackles Unsafe lifting. Swinging of material Damaged sling/wire rope or a chain Poor maintenance of vehicle Speedy operation Over turn Over load 	 Fatality Fractures Property damage Injury to personal Sprain and strain 	4	C	Н	 Ensure the crane and forklift engaged is tested and having valid license and the operator has valid license and approved 3rd party certificate. Engage trained and certified banks man. Lifting equipment, gears shall have third party Certificate and approval. Barrication and warning signs in to the area where lifting operation is carried out and restrict the entry. Check list should be carried out to their vehicles by the operator prior to start any work Use tagline for control of swing and alignment. The crane must be stopped when the wind speed exceeds 38km/hr. SWL should be clearly marked on the crane and should be check that is functioning. 	M (ALARP)

Ref No:
Rev.No:0
Page 3 of 12

Serial	Sub-Activities	Hazards Identified	Risks Involved		Risk Rating			Residual
No.			(People & Property)	Severity	Probability	Initial Risk	Control Measures	Risk
							 The crane and trucks shall be periodically maintained and a periodical check has been done by the maintenance team. Vehicle not to be left unattended at site (ie,to be switch off mode if required and keys removed) SWL shall not be exceeded. Load should be secured properly with the equipment. Operators and rigger must wear high level of reflecting vest and adequate PPE (Shoe, helmet, leather gloves, goggles, over all) Vehicle routes to be kept free of obstructions (with spillages being cleaned up promptly) Any reversing that is necessary should be overseen by a trained flagman / Banks man. Operator should follow the site speed limit and obey the traffic rules. Colour coded system to be implemented to all lifting equipments as per the month. 	
5.	Traffic and road management	 Collision with vehicles/ fixed installations Poor identification Unauthorized/ untrained Operator/ driver, banks men Poor access for vehicle Public movement 	 Fatality Property damage Fracture Penalty/ compensation 	4	В	М	 Prior to start obtain all relevant approval from traffic department in connection to the use of road. PTW to be approved from Company/Contractor prior to start the activity. Trained and experienced operator/ driver and banks men to be appointed for the activity. Restricted to unauthorized and public to enter the area. Public vehicles and transport to be restrict to enter the work area and proper alternative way to be provided. 	Low (ALARP)

Ref No:

Rev.No:0 Page 4 of 12

Serial	Sub-Activities	Hazards Identified	Risks Involved	Risk Rating				Residual
No.		(Generic & Task)	(People & Property)	Severity	Probability	Initial Risk	Control Measures	Risk
							 Warning sign boards to be placed and area to be well barricaded. High visibility vest to be provided to flagman to increase visibility. Flagman to be positioned to the areas wherever required. Close supervision to be done at all times. 	
6.	Installation of booster pumps	 Unauthorized, Untrained Workers Slip, trip and fall Collision 	• Fractures • Eye damage • Skin damage • Property damage	3	С	М	 Authorized personnel to undertake the job Warning signs and barrication to be provide around the area to restrict the other workers of the hazards. Maintain a good housekeeping policy to prevent slip, trip, fall hazards Close supervision to be done at all times. Proper communication to be maintained between the workers while doing the activity Appropriate PPE to be worn while during the installation (Helmet, shoe, vest, overall, Leather gloves, goggles.) 	Low (ALARP)
7.	Handling chemicals (Solvent cement)	 Unauthorized, untrained workers Spillage Poor ventilation Fire Health hazards (External / Internal) 	 Skin injury Ingestion Eye injury Environment affect Property damage Occupational health 	3	С	М	 Ensure the chemicals are stored as per the manufacturer recommendation and identification. Adequate lighting and ventilation to be provided MSDS to be referred prior and to follow the manufacturer instruction 	ow (ALARP)

Ref No:

Rev.No:0 Page 5 of 12

Serial	Sub-Activities	b-Activities Hazards Identified (Generic & Task)	Risks Involved	Risk Rating				Residual
No.			(People & Property)	Severity	Probability	Initial Risk	Control Measures	Risk
							 Trained and authorized person to do the job Only required quantity to take for the work Do not store chemicals at non designated areas. Old/ empty container return to store for proper Dispose Container should check for leakage before Handling Personnel hygiene to be maintained while after use of chemicals All spillage shall be clean by sand or other absorbent materials Rubber gloves, overall, helmet, vest, shoe, Goggles, mask to be worn while during the activity 	
8.	Working with Hand tools (Hack saw, torque wrench, spanner)	 Slip, trip and fall Damaged warn out hand tools Flying objects Mushroom Heads Using incorrect type 	 Fatigue Trigger finger Cuts and abrasions 	3	С	М	 Defective tools should not be issued or used to perform the task, to be checked by store keeper Don't extend the spanner by using a pipe as an extension bar Hand tools shall be free from oil, grease & etc. Chisel's head shall have safety cap to avoid finger injury. Never use a file as a lever Never use a screw driver as a chisel Use eye/ face protection when there is flying materials hazard, wear gloves while required to protect the hands Use right tools for the job 	Low (ALARP)

Ref No:
Rev.No:0
Page 6 of 12

Serial	Sub-Activities	Hazards Identified Risks Involved	Bisks Involved	Risks Involved Risk Rating				Residual
No.			(People & Property)	Severity	Probability	Initial Risk	Control Measures	Risk
9.	Working with power tools (Drill machine)	 Defective equipment Electricity Improper use of equipment Poor maintenance Untrained workers Flying object Noise and vibration Fire Dust 	 Hearing losses Eye injury Crushing Back injury Burns Electrocution Ringing in the ear / Deafness 	3	C	М	 PTW to be applied and obtained prior to start, If spark producing activity is performed Defective tools should not be issued or used to perform a task. Monthly inspection should be carried out by the electrician and record to be kept at the store All portable power tools should be fitted with adequate fuse protection either in the tool body or in its electrical plug. The weight, size and type of tool should be selected to suit the job being carried out. Don't lay the cables around the access way, it should be proper routing Industrial distribution board and socket only to be used at site No joints shall be made in electrical cable. Cable hangers shall be used to avoid the direct contact of power tools cable with the scaffolding members. Electrical connection shall be routed through ELCB only. Correct rate of ELCB should be used (Ex:- 30ma only acceptable) Only those persons who have been adequately trained and experienced in the use of the tool should be allowed to use the same. Power tools shall have inspection sticker. Tools should be stored and maintained in good working condition. Appropriate PPE Should use (Goggles, Mask, Ear plug, Gloves, Shoe, Helmet, Overall, Vest) 	M (ALARP)

Ref No:
Rev.No:0
Page 7 of 12

Serial	Sub-Activities	Hazards Identified	Risks Involved		Risk Rating			Residual
No.		(Generic & Task)	(People & Property)	Severity	Probability	Initial Risk	Control Measures	Risk
10.	Working with ladder	 Person/ material falling from height Over reaching Over loading Obstructing the access way Slippery or uneven surface 	 Sprain and strain Fracture Injury to the person 	3	С	М	 The ladder should extend minimum one meter from the top for safe movement Heavy materials should not be carried Do not erect in slippery, uneven surface Should be set up with a 4 vertical to 1 horizontal slope (4:1) Inspection and maintenance to be registered and recorded by the store keeper Step ladder must fully open and lock and the devices to be as per manufacturer Defective ladder should not be used and report it immediately Do not work from the top of two rungs Remember the 3 point contact Do not work in front of the door. If work is carried then locked the door or blocked off Ladder to be used for short duration works only limited to 15 min. Colour coded system to be implemented 	Low (ALARP)
11.	Operating with Thread Machine	 Defective Machine Improper use of Machine Poor maintenance Untrained, Unauthorized Workers Slip, trip and fall Spillage 	 Cuts Crush Skin Effect Entanglement Eye, finger injury Fracture 	3	С	М	 Polythene sheets to be laid and drip trays to be placed below the machine to prevent spillages. Defective machine should not be used to perform a task. Only those persons who have been adequately trained and experienced in the use of the machine should be allowed to use the same. Machine should be maintained in good working Condition. All spillages must be clean immediately 	M (ALARP)

Ref No:

Rev.No:0 Page 8 of 12

Serial	Sub-Activities	Hazards Identified	Risks Involved		Risk Rating			Residual
No.		(Generic & Task)	(People & Property)	Severity	Probability	Initial Risk	Control Measures	Risk
							 Waste oil should be disposed in an approved manner Operator should check the machine condition prior to start the work. Adequate lighting and ventilation to be Provided. Don't lay the cables around the access way, it should be proper routing Industrial distribution board and socket only to be used at site No joints shall be made in electrical cable. Electrical connection shall be routed through ELCB only and should be used (Ex:-30ma only acceptable) Fire extinguisher to be provided Area to be barricade and provide signage. Good housekeeping should be maintained. Personnel protective equipment to be worn (helmet, shoe, overall, vest, gloves, goggles, mask) 	
12.	Welding work (arc)	 Fire Untrained, Unauthorized Worker Poor signage and barricade Lighting and ventilation 	•Electric Shock •Burns •Skin Effect •Eye Injury •Property damage	4	С	Н	 PTW to be applied and obtained prior to start. Certified person only undertake the welding job All Flammable /combustible materials should be removed from the area where welding & gas cutting operations are carried out. Fire blankets should be used to contain sparks and molten metal's within the floor and should not be allowed to fall from height. Warning signs and boards should be provided And area to be well barricaded 	Low (ALARP)

PROJECT N	AME
------------------	-----

Ref No: Rev.No:0 Page 9 of 12

Serial	Sub-Activities	Hazards Identified	Risks Involved	Risk Rating				Residual
No.		(Generic & Task)	(People & Property)	Severity Probability		Initial Risk	Control Measures	Risk
							 Appropriate fire extinguisher should be placed in to the work area (Dry powder, CO2, Fire blanket) Adequate lighting and ventilation to be Provided. Close supervision to be done at all times. Hoses should be of approved type and should be free. Appropriate PPE Should use (Face shield, Dust mask, Goggles, Gloves, Shoe, Helmet, Overall, Vest) 	
13.	Booster pump testing by use of multi meter and ammeter	 Unauthorized/ untrained Person Faulty Instrument Improper identification Electricity Fire 	 Fatality Electrocution Cut and abrasion Property damage 	3	В	М	 PTW to be applied and obtained prior to start work Ensure that the circuit is not live before using the instrument. Calibrated / certified instrument only shall be used. Warning boards should be provided and Barricaded. Electrical work shall not carry out in wet Conditions. Do not overload to the circuits. Don't use homemade electrical accessories and use industrial type only. Defective tools and equipment should not be used, report it and replaced it immediately. 	Low (ALARP)

PROJECT NAME

Ref No:
Rev.No:0
Page 10 of 12

Serial	Sub-Activities	Hazards Identified	Risks Involved		Risk Rating		Control Measures	Residual Residual
No.		(Generic & Task)	(People & Property)	Severity	Probability	Initial Risk	Control Measures	Risk
14.	While working at night shift	 Poor illumination Slip/trip/fall	• Fatality • Cuts	3	В	М	 Proper illumination to be provided light post to be secured from fall Proper cable management system to be Followed All materials to be staged in proper manner without obstacles 	Low (ALARP)
15.	Working in hot weather	• Heat Stress	DehydrationSunburnSkin Cancer	2	В	Μ	 Drink plenty of water Employees shall be trained about heat stress symptoms & first aid measures. Avoid highly physical tasks during the hottest part of the day Isotonic drinks to be provided Provide sufficient rest breaks based on the humidity & temperature conditions 	Low (ALARP)
16.	Pressure and leakage testing	 Untrained, unauthorized Workers Faulty pressure gauge Poor lighting Improper identification Bursting of pipes 	• Fatality • Property damage • Fractures • Full body injury	4	В	М	 Experienced and authorized personnel only to do the job. PTW to be applied and obtained prior to start work. Calibrated pressure gauge only to be used for pressure testing Never pressure test the system/ pipe above its designed pressure. Never do hot work on a pressurized system (always de-pressurize) Proper lighting to be provided in around the working area. Warning signs and boards should be provided And area to be well barricaded Close supervision must be done at all times. 	Low (ALARP)

	A	CTIVITY- INS	STALLATION OF W	PROJEC VATER BOOS				Ref No: Rev.No:0 Page 11 of 12	
				Severity	Probability	Initial Risk			
							available according to to the workforce prior • Trained first aider, f	rt the activity. ion plan shall be readily o site condition and briefed	
17.	Work Completion	 Poor housekeeping Slip/trip/fall 	g • Fire	2	A	L	unwanted waste mate	ng, Remove all surface, rials from the building utions will be adopted to	Low (ALARP)

RISK MATRIX

Probability

	ACTIN	/ITY- IN	NSTALLATIO		OJECT NAI			Ref No: Rev.No:(Page 12 d		
					А	В	C	D	E	
Severity	People	Assets	Environment	Reputation	Improbable 1 in 100,000 Years	Remote 1 in 10,000 Years	Occasional 1 in 1000 years	Probable 1 in 100 years	Frequent 1 in 10 years	
5-Catatrophic	Multiple fatalities or permanent total disabilities	Extensive damage	Massive effect	International impact						
4-Severe	Single fatalities or permanent total disabilities	Major damage	Major effect	National impact				High Ri	sk	
3-critical	Major injury or health effects	Local damage	Localised effect	Considerable impact		Medium Ri (ALARP)				
2-Marginal	Minor injury or health effects	Minor damage	Minor effect	Minor impact						
1-Negligble	Slight injury or health effects	Slight Damage	Slight effect	Slight impact		Low Risk				

HIGH	3-E 4-C,D,E 5-B,C,D,E
MEDIUM	1-D,E 2-B,C,D,E 3-A,B,C,D 4-A,B 5-A
LOW	1-A,B,C 2A